

Issued 1954-01  
Cancelled 2003-01


Superseding J725 MAR1991

Mounting Brackets and Socket for Warning Lamp and  
Slow-Moving Vehicle (SMV) Identification Emblem

**Foreword**—This document has been superseded by ASAE S277.2.

## 1. Scope

- 1.1** The bracket shown in Figure 1 is intended for fixed attachment to the SMV emblem and to provide, through the tapered portion, a means of detachably mounting the emblem assembly in cooperation with the socket shown in Figure 2.
- 1.2** The bracket shown in Figure 3 is intended for fixed attachment to the warning lamp and to provide, through the tapered portion, a means of detachably mounting the warning lamp assembly in cooperation with the socket shown in Figure 2.
- 1.3** The socket shown in Figure 2 is intended for fixed attachment to accommodate the tapered portion of brackets shown in Figures 1 and 3.
- 1.4 Purpose**—This SAE Standard defines mounting devices for use with warning lamps and SMV emblems.

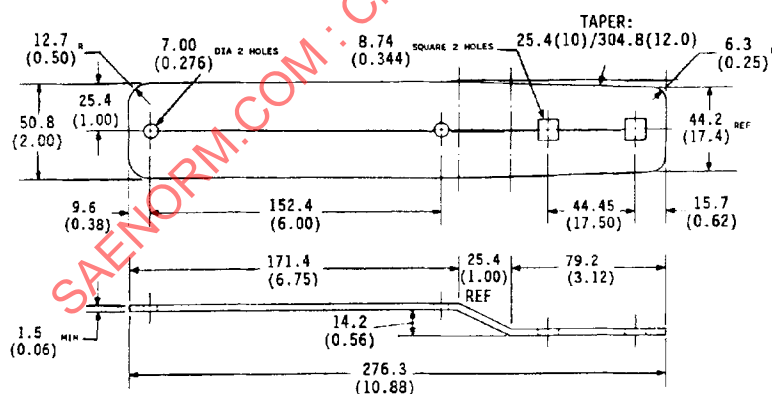**TOLERANCES:**

(x)  $\pm 1.52$  (0.060)  
(xx)  $\pm 0.76$  (0.030)  
(xxx)  $\pm 0.25$  (0.010)  
ANGLES  $\pm 1$  DEG

DIMENSIONS ARE MM (IN)

FIGURE 1—BRACKET FOR SMV EMBLEM

SAE Technical Standards Board Rules provide that: "This report is published by SAE to advance the state of technical and engineering sciences. The use of this report is entirely voluntary, and its applicability and suitability for any particular use, including any patent infringement arising therefrom, is the sole responsibility of the user."

SAE reviews each technical report at least every five years at which time it may be reaffirmed, revised, or cancelled. SAE invites your written comments and suggestions.

Copyright ©2003 Society of Automotive Engineers, Inc.

All rights reserved. No part of this publication may be reproduced, stored in a retrieval system or transmitted, in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, without the prior written permission of SAE.

TO PLACE A DOCUMENT ORDER:

Tel: 877-606-7323 (inside USA and Canada)  
Tel: 724-776-4970 (outside USA)  
Fax: 724-776-0790  
Email: [custsvc@sae.org](mailto:custsvc@sae.org)  
<http://www.sae.org>

SAE WEB ADDRESS:

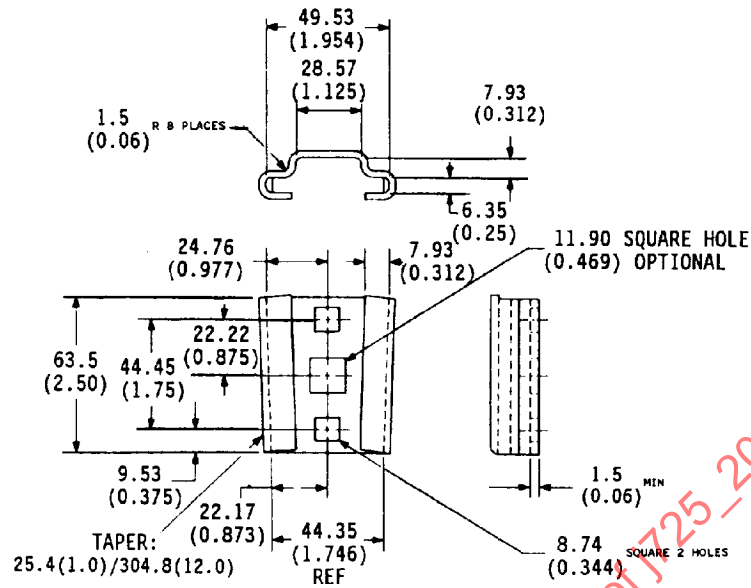


FIGURE 2—SOCKET

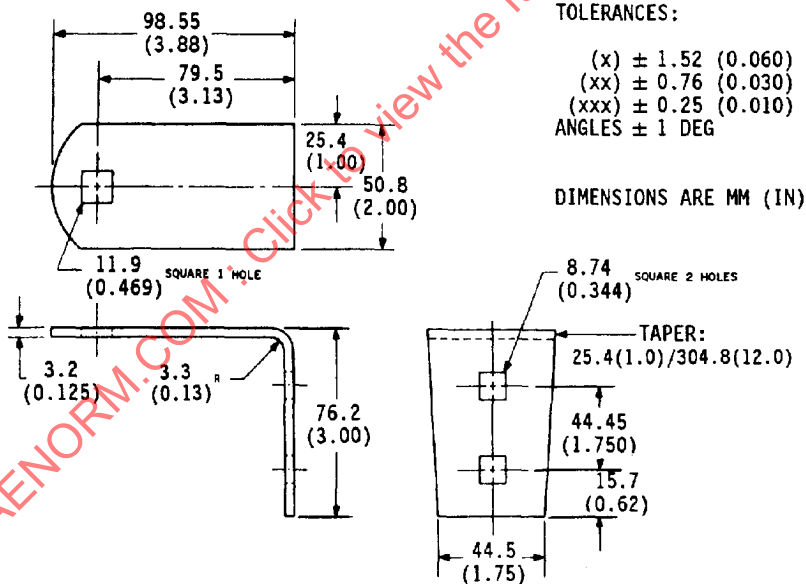


FIGURE 3—BRACKET FOR WARNING LAMP

2. **References**—There are no referenced publications specified herein.